

147340600

CORNER FILE TRACKING

S:\Survey Corners\CORNERS\Templates\Filetrac2.doc
10/04/2010

CORNER NUMBER
147340600

STEP	HISTORY	RESTORATION
Form Prepared, DB	10/17/10	
Field Inspection, DB		
Finish index (count unit)	10/17/10	
Counter Index		
GIS Index Form		
Checked, DB		
Form Edited, DB		
Form Signed, DB		
Authorize Payment, DB		
Archive Digital Files		
Collect Documents		
PDF File		
Copy For Filming		
Scanned (pdf to laserfiche)		
Filmed (Archived), DB		
Filed, DB		

(DB) = Entry needed in database (Access).

COMMENTS:

DATE 10/17/2016

TOWNSHIP 14 SOUTH, RANGE 7 WEST, WILLAMETTE MERIDIAN; SECTION 4 CORNER SOUTH 1/4
DONATION LAND CLAIM N/A CORNER N/A

COMMON CORNER(S):

NORTH 1/4 CORNER SECTION 9

RECORDS (INFORMATION IN BOLD ITALICS IS COUNTY STAFFS' INTERPRETATION OF THE RECORD)

BASED ON EXTENSIVE RESEARCH AND RECOVERY OF EVIDENCE, THIS OFFICE HAS DETERMINED THAT MOST GENERAL LAND OFFICE SURVEYORS IN BENTON COUNTY MEASURED TO THE FACE OF BEARING TREES.

[01] GENERAL LAND OFFICE (GLO) NOTES BY CHARLES M. COLLIER, D.S., DATED MAY 12, 1893. SET POST 3 FEET LONG, 3" SQUARE, ***24"*** IN GROUND, MARKED "***1/4S***" ON NORTH FACE FROM WHICH A FIR 12" DIA BEARS N25°E, 18 LINKS (11.88 FEET) MARKED "***1/4S BT***"; A FIR 10" DIA BEARS S10°E, 39 LINKS (25.74 FEET) MARKED "***1/4S BT***".

[02] BUREAU OF LAND MANAGEMENT (BLM) NOTES BY LARRY D. EVANS, CADASTRAL SURVEYOR, DATED MARCH 23, 1977. THE 1/4 SECTION CORNER DETERMINED AT RECORD DISTANCE FROM THE ORIGINAL BEARING TREES, A FIR STUMP 36" DIA (GLO BT) BEARS N30°E, 18 LINKS (11.88 FEET), WITH HEALED BLAZE; A FIR 37" DIA (GLO BT) BEARS S10°E, 39 LINKS (25.74 FEET), WITH HEALED BLAZE. AT THE CORNER POINT SET AN IRON POST, 28" LONG, 2-1/2" DIA, 24" IN THE GROUND, WITH BRASS CAP MARKED "***T14S R7W S4 1/4 S9 1976***" FROM WHICH A FIR 40" DIA BEARS S86°W, 61 LINKS (40.26 FEET) MARKED "***X BT***".

[03] BENTON COUNTY CORNER RESTORATION NO. 2510. TRANSCRIBED FROM RECORD [02] AND MAY CONTAIN ERRORS AND/OR OMISSIONS.

[04] BUREAU OF LAND MANAGEMENT (BLM) PLAT BY ROYCE W. HILL, CADASTRAL SURVEYOR, DATED MARCH 27, 2008. CORNER NOT DESCRIBED.

[05] BUREAU OF LAND MANAGEMENT (BLM) CORRECTION PLAT BY ROYCE W. HILL, CADASTRAL SURVEYOR, DATED APRIL 15, 2008. CORNER NOT DESCRIBED.

FIRM/AGENCY: BENTON COUNTY SURVEYOR'S OFFICE
ADDRESS: 360 S.W. AVERY AVE., CORVALLIS, OR 97333; PH. 541-766-6821
RESEARCH BY: DAVID L. MALONE, P.L.S.
DATA ENTRY BY: SAME

BENTON COUNTY SURVEYORS OFFICE - CORNER RESTORATION

2510


T 14 S, R. 7 W, W. B. & M., BENTON COUNTY, OREGON

REPORTED BY Evans

SECTION 4

TITLE Cadastral Surveyor

DATE March 1977

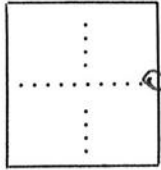

● OFFICIAL CORNER FOUND

○ CORNER SET

$\frac{1}{4}$ CORNER COMMON TO SEC. 4 9 & _____
 IS iron post 2 1/2" x 28" w/ brass cap

DESCRIBE

ADDITIONAL INFORMATION

36" fir stump - N 30° E, 18 IKs w/ healed blaze
37" fir - S. 10° E, 39 IKs w/ healed blaze

SEE PG. 23 OF THE BLM FIELD NOTES IN THE T14S
R7W FILE IN THE CORNER RESTORATION COR-
RESPONSE FILE DRAWER (CPL 7/23/90).

OVER

LEGIBLE MARKS ON BEARING OBJECTS

" X BT "				
KIND	<u>Fir</u>			
SIZE	<u>40"</u>			
BEARING	<u>S. 86° W</u>			
DISTANCE	<u>61 IKs</u>			
BT TAG POSTED				