

158100640

DATE 01/13/2020TOWNSHIP 15 SOUTH, RANGE 8 WEST, WILLAMETTE MERIDIAN; SECTION 6 CORNER WEST 1/4
DONATION LAND CLAIM N/A CORNER N/A**COMMON CORNER(S):**

EAST 1/4 CORNER SECTION 1, TOWNSHIP 15 SOUTH, RANGE 9 WEST

RECORDS (INFORMATION IN *BOLD ITALICS* IS COUNTY STAFFS' INTERPRETATION OF THE RECORD)

BASED ON EXTENSIVE RESEARCH AND RECOVERY OF EVIDENCE, THIS OFFICE HAS DETERMINED THAT MOST GENERAL LAND OFFICE SURVEYORS IN BENTON COUNTY BEFORE 1890 MEASURED TO THE FACE OF BEARING TREES.

- [01] GENERAL LAND OFFICE (GLO) NOTES BY ALONZO GESNER, D.S., DATED JUNE 25, 1891. *SET CHERRY POST 3 FEET LONG, 3" SQUARE, 24" IN GROUND, MARKED "1/4S" ON WEST FACE, FROM WHICH A CHERRY 8" DIA BEARS S56°W, 21 LINKS (13.86 FEET), MARKED "1/4S BT"; RED FIR 10" DIA BEARS S32°E, 44 LINKS (29.04 FEET), MARKED "1/4S BT".*
- [02] BENTON COUNTY SURVEY NO. 501 FIELD NOTES (FIELD BOOK 18, PAGE 64) BY W. C. GALLOWAY, C.S., DATED MARCH 4, 1915. *SET 3/4" X 3/4" IRON BAR, ORIGINAL CORNER. FIR 10" DIA (GLO BT) BEARS S27°E, 0.43 CHAINS (28.38 FEET), STANDING; CHERRY 8" DIA (GLO BT) BEARS S56°W, 0.21 CHAINS (13.86 FEET), STANDING.*
- [03] BENTON COUNTY CORNER RESTORATION BOOK NO. 1, PAGE 93, BY W. C. GALLOWAY, C.S., DATED MARCH 4, 1915. *SET 3/4" X 3/4" IRON BAR, ORIGINAL CORNER. FIR 10" DIA (GLO BT) BEARS S27°E, 0.43 CHAINS (28.38 FEET), STANDING; CHERRY 8" DIA (GLO BT) BEARS S56°W, 0.21 CHAINS (13.86 FEET), STANDING.*
- [04] BENTON COUNTY CORNER RESTORATION NO. 2961. *TRANSCRIBED FROM RECORD [03] AND MAY CONTAIN ERRORS AND/OR OMISSIONS.*
- [05] BENTON COUNTY MAP NO. 15-8-00002 BY W. C. GALLOWAY, C.S., DATED OCTOBER, 1915. *3/4" X 3/4" IRON BAR. FIR 10" DIA (GLO BT) BEARS S27°E, 0.43 CHAINS (28.38 FEET), STANDING; CHERRY 8" DIA (GLO BT) BEARS S56°W, 0.21 CHAINS (13.86 FEET), STANDING.*
- [06] BENTON COUNTY SURVEY NO. 644 (OLD NO. 243) FIELD NOTES (FIELD BOOK 26, PAGE 38) BY W. C. GALLOWAY, C.S., DATED NOVEMBER 7, 1918. *CORNER NOT DESCRIBED.*
- [07] BUREAU OF LAND MANAGEMENT (BLM) NOTES BY STEPHEN D. HARDIN, CADASTRAL SURVEYOR, DATED FEBRUARY 16, 1979. *POINT AT PROPORTIONATE DISTANCE, THERE IS NO REMAINING EVIDENCE OF THE ORIGINAL CORNER. SET AN IRON POST, 28" LONG, 2-1/2" DIA, 22" IN THE GROUND, WITH BRASS CAP MARKED "T15S R9W R8W 1/4 S1 S6 1978" FROM WHICH A FIR 28" DIA BEARS N86-1/2°E, 60 LINKS (39.60 FEET), MARKED "1/4 S6 BT"; FIR 28" DIA BEARS N30-1/2°W, 46 LINKS (30.36 FEET), MARKED "1/4 S1 BT".*
- [08] BENTON COUNTY CORNER RESTORATION NO. 2964 BY STEPHEN D. HARDIN, CADASTRAL SURVEYOR, DATED JULY 20, 1982. *FOUND 3/4" X 3/4" IRON ROD, FIRMLY SET, PROJECTING 2" ABOVE GROUND. FIR 49" DIA (GLO BT) BEARS S23-1/2°E, 45 LINKS (29.70 FEET). THE 1/4 CORNER WAS PROPORTIONED IN 1978. IN 1982 THE ORIGINAL 1/4 CORNER WAS FOUND. THE BEARING AND DISTANCE FROM THE ORIGINAL 1/4 CORNER TO THE 1978 PROPORTIONED 1/4 CORNER IS S74°16'W, 71.10 FEET.*
- [09] BUREAU OF LAND MANAGEMENT (BLM) NOTES BY STEPHEN D. HARDIN, CADASTRAL SURVEYOR, DATED MARCH 7, 1983. *THE 1/4 SECTION CORNER MONUMENTED WITH AN IRON BAR, 3/4" SQUARE, FIRMLY SET, PROJECTING 4" ABOVE GROUND, FROM WHICH A FIR 50" DIA (GLO BT) BEARS S27°E, 43 LINKS (28.38 FEET), WITH SCRIBE MARKS "1/4S" VISIBLE ON OPENED BLAZE. FROM THIS POINT THE 1/4 SECTION CORNER ERRONEOUSLY REESTABLISHED BY HARDIN IN 1978-79, BEARS S72°57'W, 1.068 CHAINS (70.49 FEET), SET, MARKED, AND WITNESSED AS DESCRIBED IN THE OFFICIAL RECORD. REMOVE THE IRON POST, DESTROY THE MARKS ON THE BEARING TREES, AND AT THE TRUE CORNER POINT RESET THE IRON POST, 28" LONG, 2-1/2" DIA, 24" IN THE GROUND, DIRECTLY OVER THE IRON BAR, WITH BRASS CAP MARKED "T15S R9W R8W 1/4 S1 S6 1983 1978" FROM WHICH A FIR 28" DIA BEARS N23°E, 39-1/2 LINKS (26.07 FEET), MARKED "1/4 S6 BT"; FIR 45" DIA BEARS S80°W, 54 LINKS (35.64 FEET), MARKED "1/4 S1 BT".*
- [10] BUREAU OF LAND MANAGEMENT (BLM) NOTES BY STEPHEN D. HARDIN, CADASTRAL SURVEYOR, DATED SEPTEMBER 29, 1986. *THE 1/4 SECTION CORNER MONUMENTED WITH AN IRON POST, 2-1/2" DIA, FIRMLY SET, PROJECTING 6" ABOVE GROUND, WITH BRASS CAP MARKED "T15S R9W R8W 1/4 S1 S6 1983 1978" FROM WHICH A FIR 50" DIA (GLO BT) BEARS S27°E, 43 LINKS (28.38 FEET), NO MARKS VISIBLE ON PITCHED OVER BLAZE; FIR 29" DIA (BLM BT) BEARS N23°E, 39-1/2 LINKS (26.07 FEET), WITH ILLEGIBLE SCRIBE MARKS VISIBLE ON PITCHED OVER BLAZE; FIR 47" DIA (BLM BT) BEARS S80°W, 54 LINKS (35.64 FEET), NO MARKS VISIBLE ON PITCHED OVER BLAZE.*

FIRM/AGENCY: BENTON COUNTY SURVEYOR'S OFFICE**ADDRESS:** 360 S.W. AVERY AVE., CORVALLIS, OR 97333; PH. 541-766-6821**RESEARCH BY:** DAVID L. MALONE, P.L.S.**DATA ENTRY BY:** SAME

BENTON COUNTY SURVEYORS OFFICE - CORNER RESTORATION

02964


T 15 S, R 8 W, W. B. & M., BENTON COUNTY, OREGON

SECTION 6

REPORTED BY Stephen D. Hardin

TITLE Cadastral Surveyor. BLM

DATE 7-20-82

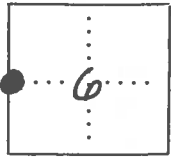

● OFFICIAL CORNER FOUND

○ CORNER SET

LEGIBLE MARKS ON BEARING OBJECTS

1/4 CORNER COMMON TO SEC. 1 & 6
 IS 3/4 x 3/4" iron rod
 DESCRIBE

ADDITIONAL INFORMATION

1/4 1+6, Tp. 15S, Rs. 8+9W,
perpetuated + recorded by W.C.
Galloway in 1915, monumented
with an iron rod, firmly set
projecting 2" above ground.

over

OVER

← ORIG
 KIND Fir
 SIZE 49"
 BEARING S. 23 1/2° E.
 DISTANCE 45 1/5.
 BT TAG POSTED NO

The 1/4 of secs. 1+6, was proportioned in during a 1978 Cadastral survey. Later, in 1982, the orig 1/4 of secs. 1+6 was found by Cadastral (BLM).
 The bearing + distance from the original 1/4 cor. to the 1978 proportioned 1/4 is: S. 74° 16' W., 71.10' distance.
 For further info. call BLM, Salem District office

CORNER RESTORATION BOOK NO. 1

- C.S. #196 cont. S.E. cor. of Britton Wood Cl. # 64 T. 11S. R. 6W.
 Set $\frac{1}{2} \times \frac{1}{2}$ " iron bar stake hole
 W. fir 5" bears S. 84° E. 194 chs.
 " " 12" " N. 6° W. 77" " stake
 Witnesses Edwin Johnson, L.H. Hawley John Hiller March 1915.
- " S.E. cor. of Wm Blodgett Cl. #40 T. 11S. R. 7W.
 Set $\frac{3}{4}$ " pipe 2 stones orig. cor.
 Oak 10" bears N. 1° W. 51 chs. std.
 Witness John Hiller March 1915.
- " Int. cor. of Wm Blodgett Cl. #40 T. 11S. R. 7W.
 Set $\frac{3}{4}$ " pipe oak cutdown N. 58° E. 2.23 chs.
 Fir 24" bears N. 81° E. .093 chs.
 " 24" " N. 45° W. .043 "
 Witness John Hiller March 1915.
- C.S. Miscellaneous $\frac{1}{4}$ sec. cor. between secs. 1 & 6 T. 15 S. Rs. 8 & 9 W.
 Set $\frac{3}{4} \times \frac{3}{4}$ " iron bar orig. cor.
 Fir 10" bears S. 27° E. .43 chs. std.
 Cherry 8" " S. 56° W. .21 " "
 Witnesses Oliver Davis Lee Anderson, D.C. Johnson Mar. 7, 1915.
- C.S. Road #377 Sec. cor. on S. line of sec. 32, on 2nd std. parallel Tps. 10 & 11 S. R. 7 W.
 Pit with C.S. 229 Set $\frac{3}{4}$ " pipe
 Burnt snag 50" bears N. 54° W. .810 chs. std.
 Fir 28" bears N. 4° 20' E. .822 " post bothered in getting bearing.
 " 28" " N. 84° W. .562 "
 Witnesses Fred Haidler, Jerry Barchard & Rudolph Long April 1915.
- C.S. #245 in C.S. Road #359 S.W. cor. of Nimrod O'Kelly Cl. #59 T. 13S. R. 5W.
 Set $\frac{5}{8} \times 1\frac{1}{8}$ " iron pin con. of road
 Anchor post 10" North .307 chs.
 Witness J.S. Watkins April 22, 1915.
- " S.E. cor. of Nimrod O'Kelly Cl. #59 T. 13S. R. 5W.
 Set $1\frac{1}{4} \times 5\frac{1}{4}$ " shaft by anchor post
 Maple 28" in dia. bears N. 3° 35' E. 4.455 chs.
 Ash 15" " " " S. 89° 10' W. 6.540 "
 Witness Hugh Taylor Apr. 27, 1915.
- " N.E. cor. of Nimrod O'Kelly Cl. #59 T. 13 S. R. 5 W.
 Set a $1\frac{1}{4}$ " pipe for corner.
 A stone the most south S.W. cor. of R.D. Grimsley Cl. 49.
 bears S. 0° 26' W. 13.256 chs. a proportional distance on
 the east line of O'Kelly claim.
- " N.W. cor. of Nimrod O'Kelly Cl. #59 T. 13S. R. 5W.
 Stone 10" x 12" x 2"
 Locus 22" bears N. 50° 40' E. .827 chs.
 " 15" " S. 3° 30' E. .383 "
 Witness Hugh Taylor April 27, 1915.

$\frac{1}{4}$ -Section corner between sections 6 and 1, Twp. 15 S R 8 and 9 W 02961

Reestablishment by W. C. Galloway

March 4, 1915

3502

Set $\frac{3}{4}$ " x $\frac{3}{4}$ " iron bar

Original corner

Fir 10" in diam bears S27° E

.43 chains(standing)

Cherry 8" in diam bears S 56°

.21 chains(standing)

Witnesses Oliver Davis, Lee Anderson, O. C. Johnson