

NARRATIVE

The purpose of this survey is as follows: a) To recover monuments along the East line of the Abel Hurlbut D.L.C. No. 77, b) To monument a portion of Hurlbut Road which is being relocated, c) To monument adjoining portions of Hurlbut Road in it's original location, d) To reestablish the Northwest corner, and monument a point along the South line of Tax Lot 200 of Tax Map 13-5-24 (Tract C of Parcel 6 of 2003-351152 of the Benton County Deed Records), and e) To establish the Northwest corner of Tax Lot 200 of Tax Map 13-5-13 (Tract B of Parcel 6 of 2003-351152 of the Benton County Deed Records).

We recovered the Northeast corner of D.L.C. No. 77, and two monuments to the South as shown. At point (A) we searched for a 1/2" iron pipe as per the Hardcopy Survey of C.R. No. 621, but did not find it.

We did not recover the 1/2" iron pipe at Road P.I. 0+97.86 at the North end of Hurlbut Road. We therefore computed centerline station 0+00 at record distance, along the North line of Section 13, from the Northwest corner of Section 13. We then used record data, as per the Hardcopy Survey of C.R. No. 621, to compute the centerline of Hurlbut Road to station 25+05.00. Our computed point for 25+05.00 fell about 0.3 feet off the true centerline, 0.14 feet closer than record to the Northwest corner of D.L.C. No. 60, and 0.36 feet further than record from the 1 1/4" iron pipe at point (B). Rather than adjust out these minor differences, we held the record road data and just rotated the initial road bearing to bring 25+05.00 onto the true centerline.

At the Northwest corner of Tax Lot 200 of Tax Map 13-5-24, point (C), we found a 1 1/2" shaft lying on the ground. We reset this corner at the record deed distance of 35 rods from the found pipe at (D).

The original survey notes of the Abel Hurlbut D.L.C. call for the 1/4 corner of Sections 13 and 24 to be on the West line of said claim. GHC 13-485-00002 and the Hardcopy Survey for C.R. No. 621 treat the West claim line to be a straight line between the Northwest and Southwest claim corners, calling the 1/4 corner to be slightly off that line. The 1/4 corner was also not held to control the centerline of County Road No. 621. Our bearing and distance between the 1/2" pipe at (E) and the 1/4 corner is not intended to represent the West line of the Claim or the North-South centerline of Section 13, but is simply a tie between monuments.

Monuments found as per GHC 13-485-00002, C.S. 2439, C.S. 9253, BCCR 3918, BCCR 3922, BCCR 4102, and the Hardcopy Survey of C.R. No. 621 were held as control for this survey.

NOTE:
WESTERLY RIGHT-OF-WAY
MONUMENTS ARE SET 18"
BELOW SURFACE.

SURVEYED BY:
PETERSON & ASSOCIATES
8155 NW MITCHEL DRIVE
CORVALLIS, OREGON 97330
PHONE: 541-757-1794


TAX LOT 200

PORTION OF HURLBUT
ROAD TO BE VACATED

PORTION OF HURLBUT
ROAD TO BE DEDICATED

REGISTERED
PROFESSIONAL
LAND SURVEYOR

OREGON
JULY 31, 1976
JIM S. PETERSON
1084
RENEWAL: 12-31-10

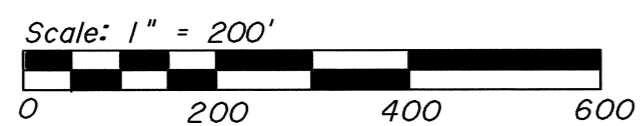

| CURVE | RADIUS | LENGTH | DELTA | CHORD | CH.BEARING |
|-------|---------|---------|-----------|---------|-------------|
| (C1) | 179.15' | 197.56' | 63°11'06" | 187.70' | S58°41'39"E |
| (C2) | 159.15' | 175.51' | 63°11'06" | 166.75' | S58°41'40"E |
| (C3) | 139.15' | 153.45' | 63°11'06" | 145.79' | S58°41'40"E |
| (C4) | 934.92' | 171.34' | 10°30'02" | 171.10' | S32°22'19"E |
| (C5) | 954.92' | 175.01' | 10°30'02" | 174.76' | S32°22'19"E |
| (C6) | 974.92' | 178.67' | 10°30'02" | 178.42' | S32°22'19"E |
| (C7) | 974.92' | 244.75' | 14°23'03" | 244.11' | S30°25'50"E |
| (C8) | 954.92' | 239.73' | 14°23'03" | 239.10' | S30°25'50"E |
| (C9) | 934.92' | 234.71' | 14°23'03" | 234.10' | S30°25'50"E |
| (C10) | 290.00' | 212.81' | 42°02'45" | 208.07' | S44°15'41"E |
| (C11) | 315.00' | 231.16' | 42°02'45" | 226.01' | S44°15'41"E |
| (C12) | 340.00' | 249.50' | 42°02'45" | 243.94' | S44°15'41"E |
| (C13) | 321.40' | 364.92' | 65°03'17" | 345.63' | S32°45'25"E |
| (C14) | 296.40' | 336.54' | 65°03'17" | 318.75' | S32°45'25"E |
| (C15) | 271.40' | 308.15' | 65°03'17" | 291.86' | S32°45'25"E |
| (C16) | 680.00' | 165.95' | 13°58'59" | 165.54' | S07°13'15"E |
| (C17) | 700.00' | 170.83' | 13°58'59" | 170.41' | S07°13'15"E |
| (C18) | 720.00' | 175.72' | 13°58'59" | 175.28' | S07°13'15"E |
| (C19) | 736.19' | 181.50' | 14°07'33" | 181.04' | S07°08'58"E |
| (C20) | 716.19' | 176.57' | 14°07'33" | 176.12' | S07°08'58"E |
| (C21) | 696.19' | 171.64' | 14°07'33" | 171.21' | S07°08'58"E |

FD. 1 1/4" IRON PIPE
PER HARDCOPY SURVEY
OF C.R. NO. 621

RECORD OF SURVEY

for **VENELL FARMS, INC.**
BENTON COUNTY

in SECTION 13, T13S, R5W, W.M.
and in SECTION 24, T13S, R5W, W.M.
and the ABEL HURLBUT D.L.C. NO. 60
BENTON COUNTY, OREGON
AUGUST 25, 2008

TAX LOT 600

