

137400500

DATE 08/10/2020

TOWNSHIP 13 SOUTH, RANGE 7 WEST, WILLAMETTE MERIDIAN; SECTION 9 CORNER SOUTHEAST
DONATION LAND CLAIM N/A CORNER N/A**COMMON CORNER(S):**SOUTHWEST CORNER SECTION 10
NORTHWEST CORNER SECTION 15
NORTHEAST CORNER SECTION 16**RECORDS (INFORMATION IN BOLD ITALICS IS COUNTY STAFFS' INTERPRETATION OF THE RECORD)**

BASED ON EXTENSIVE RESEARCH AND RECOVERY OF EVIDENCE, THIS OFFICE HAS DETERMINED THAT MOST GENERAL LAND OFFICE SURVEYORS IN BENTON COUNTY BEFORE 1890 MEASURED TO THE FACE OF BEARING TREES.

- [01] GENERAL LAND OFFICE (GLO) NOTES BY ROBERT O. COLLIER, D.S., DATED FEBRUARY 9, 1892. SET A POST 4 FEET LONG, 4" SQUARE, 24" IN GROUND, MARKED "T13SS10" ON NORTHEAST FACE, "R7WS15" ON SOUTHEAST FACE, "S16" ON SOUTHWEST FACE, AND "S9" ON NORTHWEST FACE, WITH 4 NOTCHES ON SOUTH EDGE AND 3 NOTCHES ON EAST EDGE, FROM WHICH A CEDAR 40" DIA BEARS N89°E, 24 LINKS (15.84 FEET), MARKED "T13SR7WS10BT"; CEDAR 40" DIA BEARS S5°E, 49 LINKS (32.34 FEET), MARKED "T13SR7WS15BT"; CEDAR 40" DIA BEARS S89-1/2°W, 221 LINKS (145.86 FEET), MARKED "T13SR7WS16BT"; CEDAR 48" DIA BEARS N12°W, 39 LINKS (25.74 FEET), MARKED "T13SR7WS9BT".
- [02] BENTON COUNTY SURVEY NO. 6037 BY ARNOLD BRUBAKER, P.L.S., DATED FEBRUARY 19, 1976. SET 5/8" ROD FROM FOUND CEDAR SNAG 40" DIA (GLO BT) BEARS N89°E, 15.84 FEET; CEDAR SNAG 40" DIA (GLO BT) BEARS S5°E, 32.34 FEET; CEDAR WINDFALL 40" DIA (GLO BT) BEARS S89-1/2°W, 145.86 FEET; CEDAR WINDFALL 48" DIA (GLO BT) BEARS N12°W, 25.74 FEET. MARKED CEDAR 20" DIA BEARS S75°W, 31.2 FEET; CEDAR 20" DIA BEARS N34°W, 43.15 FEET.
- [03] BENTON COUNTY CORNER RESTORATION NO. 2029. TRANSCRIBED FROM RECORD [02] AND MAY CONTAIN ERRORS AND/OR OMISSIONS.
- [04] BENTON COUNTY SURVEY NO. 6923 BY GARY T. JOHNSTON, P.L.S., DATED JUNE, 1979. FOUND 5/8" IRON ROD AND BEARING TREES. MARKED ALDER 18" DIA BEARS N19°E, 28.1 FEET, BARK SCRIBED "T13SR7WS10BT"; ALDER 18" DIA BEARS S73°E, 19.8 FEET, BARK SCRIBED "T13SR7WS10BT".
- [05] BUREAU OF LAND MANAGEMENT (BLM) NOTES BY DANNY J. NEVIN, CADASTRAL SURVEYOR, DATED SEPTEMBER 30, 1998. THE SECTION CORNER MONUMENTED WITH AN IRON ROD, 5/8" DIA, FIRMLY SET, PROJECTING 3" ABOVE GROUND, FROM WHICH A WINDFALL CEDAR (GLO BT), SIZE INDETERMINATE, BEARS N89°E, 24 LINKS (15.84 FEET), NO MARKS VISIBLE; WINDFALL CEDAR STUMP (GLO BT), SIZE INDETERMINATE, BEARS S89-1/2°W, 221 LINKS (145.86 FEET), NO MARKS VISIBLE; CEDAR 33" DIA BEARS S67-1/2°W, 48 LINKS (31.68 FEET), WITH HEALED BLAZE; CEDAR 31" DIA BEARS N42-1/2°W, 64-1/2 LINKS (42.57 FEET), WITH HEALED BLAZE; ALDER 19" DIA BEARS N10°E, 43 LINKS (28.38 FEET), WITH SCRIBE MARKS "T13S R7W S10 BT" VISIBLE ON BARK; ALDER 19" DIA BEARS S79°E, 30-1/2 LINKS (20.13 FEET), WITH SCRIBE MARKS "T13S R7W S15 BT" VISIBLE ON BARK. AT THE CORNER POINT SET A STAINLESS STEEL POST, 28" LONG, 2-1/2" DIA, 24" IN THE GROUND, DIRECTLY OVER IRON ROD, WITH BRASS CAP MARKED "T13S R7W S9 S10 S16 S15 1998".
- [06] BUREAU OF LAND MANAGEMENT (BLM) NOTES BY ROBERT L. AARSETH AND JANET R. MYERS, CADASTRAL SURVEYORS, DATED APRIL 4, 2005. THE SECTION CORNER MONUMENTED WITH A STAINLESS STEEL POST, 2-1/2" DIA, FIRMLY SET, PROJECTING 4" ABOVE GROUND, WITH BRASS CAP MARKED "T13S R7W S9 S10 S16 S15 1998" FROM WHICH A DOWN CEDAR (GLO BT), SIZE INDETERMINATE, BEARS N89°E, 15.8 FEET, WITH NO MARKS VISIBLE; DOWN CEDAR STUMP (GLO BT), SIZE INDETERMINATE, BEARS S89-1/2°W, 145.9 FEET, WITH NO MARKS VISIBLE; CEDAR 33" DIA BEARS S67-1/2°W, 31.7 FEET, WITH HEALED BLAZE; CEDAR 31" DIA BEARS N42-1/2°W, 42.6 FEET, WITH HEALED BLAZE; ALDER 19" DIA BEARS N10°E, 28.4 FEET, WITH SCRIBE MARKS "T13S R7W S10 BT" VISIBLE ON BARK; ALDER 19" DIA BEARS S79°E, 20.1 FEET, WITH SCRIBE MARKS "T13S R7W S15 BT" VISIBLE ON BARK.
- [07] BUREAU OF LAND MANAGEMENT (BLM) NOTES BY RICHARD S. KAISER, CADASTRAL SURVEYOR, DATED JULY 16, 2009. THE SECTION CORNER MONUMENTED WITH A STAINLESS STEEL POST, 2-1/2" DIA, FIRMLY SET, PROJECTING 3" ABOVE GROUND, WITH A BRASS CAP MARKED "T13S R7W S9 S10 S16 S15 1998" FROM WHICH A DOWNED CEDAR STUMP (GLO BT), SIZE INDETERMINATE, BEARS S89-1/2°W, 145.9 FEET, NO MARKS VISIBLE; CEDAR STUMP 38" DIA BEARS S67-1/2°W, 31.7 FEET, WITH HEALED BLAZE; CEDAR 39" DIA BEARS N42-1/2°W, 42.6 FEET, WITH HEALED BLAZE; ALDER 21" DIA BEARS N10°E, 28.4 FEET, WITH SCRIBE MARKS "T13S R7W S10 BT" VISIBLE ON BARK; ALDER 20" DIA BEARS S79°E, 20.1 FEET, WITH SCRIBE MARKS "T13S R7W S15 BT" VISIBLE ON BARK.

FIRM/AGENCY: BENTON COUNTY SURVEYOR'S OFFICE
ADDRESS: 360 S.W. AVERY AVE., CORVALLIS, OR 97333; PH. 541-766-6821
RESEARCH BY: DAVID L. MALONE, P.L.S.
DATA ENTRY BY: SAME

BENTON COUNTY SURVEYORS OFFICE - CORNER RESTORATION

2025

T 13 S, R 7 W, W. B. & M., BENTON COUNTY, OREGON


REPORTED BY Arnold Brubaker

SECTION 9

The information shown hereon was taken from the referenced county survey. Date: 7/26/90

TITLE Surveyor 992

DATE Feb 19, 1976

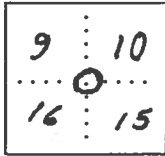

● OFFICIAL CORNER FOUND

○ CORNER SET

Sec. CORNER COMMON TO SEC. 16, 15, 10 & 9
IS 5/8" iron rod -
DESCRIBE

ADDITIONAL INFORMATION

- Original Bts Found as follows:
- (1) 40" Cedar - N89°E - 15.84' - Snag
 - (2) 40" Cedar - S5°E - 32.34' Snag
 - (3) 40" Cedar - S89½°W - 145.86' Windfall
 - (4) 48" Cedar - N12°W - 25.74' Windfall

See C.S. #6037

OVER

LEGIBLE MARKS ON BEARING OBJECTS

KIND	Cedar	Cedar	
SIZE	20"	20"	
BEARING	S75°W	N34°W	
DISTANCE	3.12"	43.15"	
BT TAG POSTED			