


137500640

BENTON COUNTY SURVEYORS OFFICE - CORNER RESTORATION

2020

T. 13 S, R. 17 W, W. B. & M., BENTON COUNTY, OREGON

SECTION 2
 The information shown hereon was taken from 226199
 the referenced county survey. Date: 2/26/99

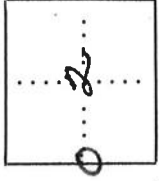

OFFICIAL CORNER FOUND

CORNER SET

IS 1/4 CORNER COMMON TO SEC. 3 & 2
584 Iron Rod

ADDITIONAL INFORMATION

Set corner from original BT found
 48" D. Fir stump with visible "BT"
 Scribe MK. N45°E 31.68'. Original
 stone gone. 6" yew - N78°W 28.42'
 gone. Original bearing trees as
 follows: (1) 40" D. Fir stump / line blaze
 N4°W 25°E. (2) 48" D. Fir stump / NO
 blaze) S77°E 10.0'

See C.S. # 6164

OVER

REPORTED BY Arnold Brubaker
 TITLE Surveyor 992
 DATE Sept. 1976

LEGIBLE MARKS ON BEARING OBJECTS

KIND	SIZE	BEARING	DISTANCE	BT TAG POSTED
D. Fir	8"	S34°E	21.25'	
D. Fir	9"	S79°W	92.0'	

DATE 09/02/2016TOWNSHIP 13 SOUTH, RANGE 7 WEST, WILLAMETTE MERIDIAN; SECTION 2 CORNER WEST 1/4
DONATION LAND CLAIM N/A CORNER N/A**COMMON CORNER(S):**
EAST 1/4 CORNER SECTION 3***RECORDS (INFORMATION IN BOLD ITALICS IS COUNTY STAFFS' INTERPRETATION OF THE RECORD)***

BASED ON EXTENSIVE RESEARCH AND RECOVERY OF EVIDENCE, THIS OFFICE HAS DETERMINED THAT MOST GENERAL LAND OFFICE SURVEYORS IN BENTON COUNTY MEASURED TO THE FACE OF BEARING TREES.

[01] GENERAL LAND OFFICE (GLO) NOTES BY ROBERT O. COLLIER, D.S., DATED FEBRUARY 9, 1892. SET A STONE 12" X 8" X 8", 8" IN GROUND MARKED "1/4" ON WEST FACE FROM WHICH A FIR 48" DIA BEARS N75°E, 48 LINKS (31.68 FEET) MARKED "1/4S BT"; A YEW 6" DIA BEARS N78-1/2°W, 37 LINKS (24.42 FEET) MARKED "1/4S BT".

[02] BENTON COUNTY SURVEY NO. 6164 BY ARNOLD BRUBAKER, P.L.S., DATED SEPTEMBER, 1976. ORIGINAL STONE GONE. SET 5/8" ROD FROM FOUND D. FIR STUMP 48" DIA (GLO BT) BEARS N75°E, 31.68 FEET, WITH VISIBLE SCRIBE MARK "BT"; YEW 6" DIA (GLO BT) BEARS N78-1/2°W, 24.42 FEET, GONE; D. FIR STUMP 40" DIA BEARS N4°W, 25 FEET ±, LINE BLAZE; D. FIR STUMP 48" DIA BEARS S77°E, 10 FEET, NO BLAZE. MARKED D. FIR 8" DIA BEARS S34°E, 21.25 FEET; D. FIR 9" DIA BEARS S79°W, 12.0 FEET.

[03] BENTON COUNTY CORNER RESTORATION NO. 2020 BY CURTIS J. LIESENFELT, P.L.S., DATED JULY 26, 1990. TRANSCRIBED FROM RECORD [02] AND MAY CONTAIN ERRORS AND/OR OMISSIONS.

[04] BENTON COUNTY SURVEY NO. 7932 BY L. W. HUNNEMULLER, P.L.S., DATED JULY - AUGUST, 1986. FOUND 5/8" REBAR FROM WHICH A FIR STUMP 48" DIA (GLO BT) BEARS N75°E, 31.7 FEET, SCRIBING "BT" VISIBLE; FIR 16" DIA BEARS S34°E, 21.3 FEET, HEALED DOUBLE BLAZE; FIR 13" DIA BEARS S79°W, 12.0 FEET, HEALED DOUBLE BLAZE. SET 3-1/4" U. S. FOREST SERVICE ALUMINUM CAP MARKED "T13S R7W 1/4 S3 S2 1986 RLS 1050" ON A 2-1/2" X 30" ALUMINUM PIPE, IN PLACE OF 5/8" REBAR. DROVE REBAR ALONGSIDE.

FIRM/AGENCY: BENTON COUNTY SURVEYOR'S OFFICE
ADDRESS: 360 S.W. AVERY AVE., CORVALLIS, OR 97333; PH. 541-766-6821
RESEARCH BY: DAVID L. MALONE, P.L.S.
DATA ENTRY BY: SAME