

**138540200**

DATE 03/09/2021TOWNSHIP 13 SOUTH, RANGE 8 WEST, WILLAMETTE MERIDIAN; SECTION 26 CORNER SOUTH 1/4  
DONATION LAND CLAIM N/A CORNER N/A**COMMON CORNER(S):**

NORTH 1/4 CORNER SECTION 35

**RECORDS (INFORMATION IN *BOLD ITALICS* IS COUNTY STAFFS' INTERPRETATION OF THE RECORD)**

BASED ON EXTENSIVE RESEARCH AND RECOVERY OF EVIDENCE, THIS OFFICE HAS DETERMINED THAT MOST GENERAL LAND OFFICE SURVEYORS IN BENTON COUNTY BEFORE 1890 MEASURED TO THE FACE OF BEARING TREES.

- [01] GENERAL LAND OFFICE (GLO) NOTES BY EDWARD F. SHARP, D.S., DATED SEPTEMBER 25, 1897. A FIR 5" DIA FOR 1/4 SECTION CORNER MARKED "1/4S" ON NORTH SIDE, FROM WHICH AN ALDER 14" DIA BEARS N6°W, 16 LINKS (10.56 FEET), MARKED "1/4SBT"; DEAD CEDAR 24" DIA BEARS S63°W, 73 LINKS (48.18 FEET), MARKED "1/4SBT".
- [02] BENTON COUNTY SURVEY NO. 7014 BY GARY T. JOHNSTON, P.L.S., DATED DECEMBER, 1979. SET 5/8" X 30" IRON ROD AT MIDPOINT ALONG THE SECTION LINE. SET 6 FOOT FIBERGLASS POST 1.0 FEET WEST. D. FIR 37" DIA BEARS S41°W, 13.9 FEET, MARKED "1/4S35BT"; D. FIR 29" DIA BEARS N7°E, 25.2 FEET, MARKED "1/4S26BT". SEARCHED FOR BUT DID NOT FIND ORIGINAL CORNER OR BEARING TREES.
- [03] BENTON COUNTY CORNER RESTORATION NO. 2171. *TRANSCRIBED FROM RECORD [02] AND MAY CONTAIN ERRORS AND/OR OMISSIONS.*
- [04] BUREAU OF LAND MANAGEMENT (BLM) NOTES BY ROBERT L. AARSETH, CADASTRAL SURVEYOR, DATED DECEMBER 12, 1989. THE 1/4 SECTION CORNER MONUMENTED WITH THE ORIGINAL CORNER TREE, A FIR 37" DIA, WITH SCRIBE MARKS "1/4" VISIBLE ON OPENED BLAZE ON NORTH SIDE, FROM WHICH A FIR 40" DIA BEARS N11-1/2°E, 32-1/2 LINKS (21.45 FEET), MARKED "1/4 S26 BT"; AN IRON POST, 28" LONG, 2-1/2" DIA, SET 24" IN THE GROUND, FOR A REFERENCE MONUMENT, BEARS S3°W, 24 LINKS (15.84 FEET), WITH BRASS CAP MARKED "RM 1/4 S35 15.84 FT 1989" AND AN ARROW POINTING TO THE CORNER. FROM THIS POINT AN IRON ROD, 5/8" DIA, FIRMLY SET, PROJECTING 2" ABOVE GROUND, BEARS N83°46'00"E, 0.209 CHAINS (13.79 FEET), FROM WHICH A FIR 29" DIA BEARS N7°E, 38 LINKS (25.08 FEET), WITH HEALED BLAZE; FIR 37" DIA BEARS S41°W, 21 LINKS (13.86 FEET), WITH HEALED BLAZE.

**FIRM/AGENCY:** BENTON COUNTY SURVEYOR'S OFFICE  
**ADDRESS:** 360 S.W. AVERY AVE., CORVALLIS, OR 97333; PH. 541-766-6821  
**RESEARCH BY:** DAVID L. MALONE, P.L.S.  
**DATA ENTRY BY:** SAME

13-8 26

BENTON COUNTY SURVEYORS OFFICE - CORNER RESTORATION

2171

T. 13 S, R. 8 W, W. B. & M., BENTON COUNTY, OREGON


SECTION 35

The information shown hereon was taken from  
the referenced county survey. Date: <sup>CSL</sup> 7/30/90

REPORTED BY Gary Johnston

TITLE RLS

DATE Dec 1979

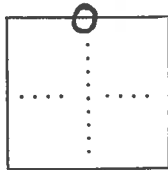

● OFFICIAL CORNER FOUND

○ CORNER SET

1/4 CORNER COMMON TO SEC. 35, 26, & \_\_\_\_\_  
IS 5/8" x 30" RR. Iron Rod  
DESCRIBE

ADDITIONAL INFORMATION

See G.S.

7014:

set Fiberglass post 40' West (6')

OVER

LEGIBLE MARKS ON BEARING OBJECTS

	<u>1/4 S 35</u> <u>BT</u> <u>W.I.I.Y</u>	<u>1/4 S 36</u> <u>BT</u> <u>W.I.I.Y</u>		
KIND	<u>D. Fir</u>	<u>D. Fir</u>		
SIZE	<u>37"</u>	<u>29"</u>		
BEARING	<u>S 41 W</u>	<u>N 07 E</u>		
DISTANCE	<u>13.9</u>	<u>25.2</u>		
BT TAG POSTED	<u>✓</u>	<u>✓</u>		

T.M.