

147440400

CORNER FILE TRACKING

S:\Survey Corners\CORNERS\Templates\Filetrac2.doc
10/04/2010

CORNER NUMBER
147440400

STEP	HISTORY	RESTORATION
Form Prepared, DB	11/16/10	
Field Inspection, DB		
Finish index (count unit)	11/16/10	
Counter Index		
GIS Index Form		
Checked, DB		
Form Edited, DB		
Form Signed, DB		
Authorize Payment, DB		
Archive Digital Files		
Collect Documents		
PDF File		
Copy For Filming		
Scanned (pdf to laserfiche)		
Filmed (Archived), DB		
Filed, DB		

(DB) = Entry needed in database (Access).

COMMENTS:

DATE 11/16/2016

TOWNSHIP 14 SOUTH, RANGE 7 WEST, WILLAMETTE MERIDIAN; SECTION 15 CORNER SOUTH 1/4
DONATION LAND CLAIM N/A CORNER N/A**COMMON CORNER(S):**

NORTH 1/4 CORNER SECTION 22

RECORDS (INFORMATION IN BOLD ITALICS IS COUNTY STAFFS' INTERPRETATION OF THE RECORD)

BASED ON EXTENSIVE RESEARCH AND RECOVERY OF EVIDENCE, THIS OFFICE HAS DETERMINED THAT MOST GENERAL LAND OFFICE SURVEYORS IN BENTON COUNTY MEASURED TO THE FACE OF BEARING TREES.

[02] GENERAL LAND OFFICE (GLO) NOTES BY CHARLES M. COLLIER, D.S., DATED MAY 12, 1893. SET POST 3 FEET LONG, 3" SQUARE, **24"** IN GROUND MARKED "**1/4S**" ON NORTH FACE FROM WHICH A FIR 10" DIA BEARS **N45-1/2°W, 107 LINKS (70.62 FEET) MARKED "1/4S BT"**; A FIR 5" DIA BEARS **S31°E, 134 LINKS (88.44 FEET) MARKED "1/4S BT"**.

[02] BUREAU OF LAND MANAGEMENT (BLM) NOTES BY LARRY D. EVANS, CADASTRAL SURVEYOR, DATED MARCH 23, 1977. THE 1/4 SECTION CORNER **MONUMENTED WITH AN IRON PIPE, 1-1/2" DIA, FIRMLY SET, PROJECTING 36" ABOVE GROUND, FROM WHICH A FIR 55" DIA (GLO BT) BEARS N43°W, 107 LINKS (70.62 FEET) WITH HEALED BLAZE; A FIR STUMP 38" DIA (GLO BT) BEARS S31°E, 134 LINKS (88.44 FEET) WITH SCRIBE MARKS "1/4S" VISIBLE ON OPEN BLAZE. AT THE CORNER POINT SET AN IRON POST, 28" LONG, 2-1/2" DIA, 24" IN THE GROUND, WITH BRASS CAP MARKED "T14S R7W S15 1/4 S22 1977" FROM WHICH A FIR 7" DIA BEARS S67°W, 56 LINKS (36.96 FEET) MARKED "1/4 S22 BT"**. RESET IRON PIPE ALONGSIDE IRON POST.

[03] BENTON COUNTY CORNER RESTORATION NO. 2570. **TRANSCRIBED FROM RECORD [02] AND MAY CONTAIN ERRORS AND/OR OMISSIONS.**

[04] BENTON COUNTY SURVEY NO. 8636 BY LES ROBERTS, P.L.S., DATED JULY 27, 1992. FOUND 1977 BLM BRASS CAP. FIR STUMP 38" DIA (GLO BT) BEARS **S31°E, 89.4 FEET, SCAR VISIBLE; FIR 56" DIA (GLO BT) BEARS N44°W, 72.4 FEET, SCAR VISIBLE; FIR 14" DIA (BLM BT) BEARS S65°W, 36.7 FEET, SCAR VISIBLE.**

[05] BENTON COUNTY SURVEY NO. 8912 BY THEODORE JAMES LANGTON, P.L.S., DATED NOVEMBER 29, 1994. FOUND BLM BRASS CAP MARKED "**T14S R7W S15 1/4 S22 1977" ON 2" PIPE IN SALAL ON TOP OF A NORTH-SOUTH RIDGE. FOUND D. FIR 20" DIA (BLM BT) BEARS S67°W, 56 LINKS (36.96 FEET), HEALED FACE; D. FIR 60" DIA BEARS S55°E, 49 FEET, TAGGED, NO MARKS; D. FIR 72" DIA BEARS N43°W, 108 LINKS (71.28 FEET), TAGGED, FACE ON NORTHEAST SIDE.**

[06] BENTON COUNTY SURVEY NO. 9522 BY JIM S. PETERSON, P.L.S., DATED DECEMBER 27, 1999. FOUND 3-1/4" BLM BRASS CAP (1977). FOUND FIR 64" DIA (GLO BT) BEARS **N43°W, 107 LINKS (70.62 FEET), SCAR ON NORTHEAST SIDE; FIR 20" DIA (BLM BT) BEARS S67°W, 56 LINKS (36.96 FEET), HEALED FACE; FIR 60" DIA BEARS S55°E, 49 FEET, NO MARKS VISIBLE; FIR STUMP 38" DIA (GLO BT) BEARS S31°E, 134 LINKS (88.44 FEET), NO MARKS VISIBLE. CORNER LIES ON NORTH-SOUTH RIDGE TOP.**

[07] BENTON COUNTY SURVEY NO. 9892 BY JIM S. PETERSON, P.L.S., DATED DECEMBER 27, 1999. **CONTAINS THE SAME INFORMATION AS C.S. 9522.**

[08] BUREAU OF LAND MANAGEMENT (BLM) NOTES BY RICHARD S. KAISER, CADASTRAL SURVEYOR, DATED MARCH 17, 2008. THE 1/4 SECTION CORNER **MONUMENTED WITH AN IRON POST, 2-1/2" DIA, FIRMLY SET, PROJECTING 5" ABOVE GROUND, WITH A BRASS CAP MARKED "T14S R7W S15 1/4 S22 1977" FROM WHICH A FIR 67" DIA (GLO BT) BEARS N44-1/2°W, 72.0 FEET, WITH A HEALED BLAZE; A FIR STUMP 22" DIA (BLM BT) BEARS S65-1/4°W, 37.0 FEET, WITH A HEALED BLAZE. NO SUITABLE NEW BEARING TREES AVAILABLE. A METAL FENCEPOST AND AN IRON PIPE, 1-1/2" DIA, FIRMLY SET, PROJECTING 38" ABOVE THE GROUND ARE LOCATED ALONGSIDE THE CORNER.**

FIRM/AGENCY: BENTON COUNTY SURVEYOR'S OFFICE**ADDRESS:** 360 S.W. AVERY AVE., CORVALLIS, OR 97333; PH. 541-766-6821**RESEARCH BY:** DAVID L. MALONE, P.L.S.**DATA ENTRY BY:** SAME

BENTON COUNTY SURVEYORS OFFICE - CORNER RESTORATION

2570


T 14 S, R 7 W, W. B. & M., BENTON COUNTY, OREGON

REPORTED BY EVANS

SECTION 15

TITLE CADASTRAL SURVEYOR

DATE MARCH 1977

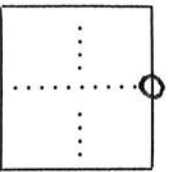

● OFFICIAL CORNER FOUND

○ CORNER SET

$\frac{1}{4}$ CORNER COMMON TO SEC. 15 22 & 22
 IS iron post 2 1/2 x 28" w/ brass cap
DESCRIBE

ADDITIONAL INFORMATION

55" Fir - N 43° W, 107 IKs w/ beaked blaze
38" Fir stump - S 31° E, 134 IKs w/ 1/4 S" on open blaze
Set iron pipe (1 1/2" dia) alongside iron post

SEE PGS 16 AND 17 OF THE BLM FIELD NOTES IN
THE T14S R7W FILE IN THE CORNER REST-
ORATION CORRESPONDENCE FILE DRAWER
(CDL 7/23/90).

LEGIBLE MARKS ON BEARING OBJECTS

1/4 522
BT

KIND Fir
 SIZE 7"
 BEARING S 67° W
 DISTANCE 56 IKs

BT TAG POSTED

OVER