

147500600

CORNER FILE TRACKING

S:\Survey Corners\CORNERS\Templates\Filetrac2.doc
10/04/2010

CORNER NUMBER
147500600

STEP	HISTORY	RESTORATION
Form Prepared, DB	11/22/16	
Field Inspection, DB		
Finish index (count unit)	11/22/16	
Counter Index		
GIS Index Form		
Checked, DB		
Form Edited, DB		
Form Signed, DB		
Authorize Payment, DB		
Archive Digital Files		
Collect Documents		
PDF File		
Copy For Filming		
Scanned (pdf to laserfiche)		
Filmed (Archived), DB		
Filed, DB		

(DB) = Entry needed in database (Access).

COMMENTS:

DATE 11/22/2016TOWNSHIP 14 SOUTH, RANGE 7 WEST, WILLAMETTE MERIDIAN; SECTION 2 CORNER SOUTHWEST
DONATION LAND CLAIM N/A CORNER N/A**COMMON CORNER(S):**SOUTHEAST CORNER SECTION 3
NORTHEAST CORNER SECTION 10
NORTHWEST CORNER SECTION 11**RECORDS (INFORMATION IN BOLD ITALICS IS COUNTY STAFFS' INTERPRETATION OF THE RECORD)**

BASED ON EXTENSIVE RESEARCH AND RECOVERY OF EVIDENCE, THIS OFFICE HAS DETERMINED THAT MOST GENERAL LAND OFFICE SURVEYORS IN BENTON COUNTY MEASURED TO THE FACE OF BEARING TREES.

- [01] GENERAL LAND OFFICE (GLO) NOTES BY CHARLES M. COLLIER, D.S., DATED MAY 12, 1893. SET POST 4 FEET LONG, 4" SQUARE, 24" IN GROUND, MARKED "T14S S2" ON NORTHEAST FACE, "R7W S11" ON SOUTHEAST FACE, "S10" ON SOUTHWEST FACE, AND "S3" ON NORTHWEST FACE WITH 2 NOTCHES ON THE EAST EDGE AND 5 NOTCHES ON THE SOUTH EDGE, FROM WHICH A CEDAR 36" DIA BEARS N6-1/2°E, 50 LINKS (33.00 FEET) MARKED "T14S R7W S2 BT"; A HEMLOCK 8" DIA BEARS S46-1/2°E, 15 LINKS (9.90 FEET) MARKED "T14S R7W S11 BT"; A CEDAR 12" DIA BEARS S64°W, 39 LINKS (25.74 FEET) MARKED "T14S R7W S10 BT"; A HEMLOCK 8" DIA BEARS N16-1/4°W, 8 LINKS (5.28 FEET) MARKED "T14S R7W S3 BT".
- [02] BENTON COUNTY CORNER RESTORATION NO. 2496 BY R. WILSON HUTCHISON, P.E., DATED FEBRUARY 18, 1958. FOUND CEDAR 36" DIA (GLO BT) BEARS N6°30'E, 50 LINKS (33.00 FEET); CEDAR 12" DIA (GLO BT) BEARS S64°00'W, 39 LINKS (25.74 FEET); HEMLOCK 8" DIA (GLO BT) BEARS N16°15'W, 8 LINKS (5.28 FEET), POOR CONDITION. SET TRUCK AXLE WITH 6" FLANGE, PAINTED YELLOW. FIR 18" DIA BEARS S33°E, 7.80 FEET, MARKED "S11 BT"; HEMLOCK 10" DIA BEARS N42°W, 28.2 FEET, MARKED "S3 BT".
- [03] BUREAU OF LAND MANAGEMENT (BLM) NOTES BY LARRY D. EVANS, CADASTRAL SURVEYOR, DATED MARCH 23, 1977. THE SECTION CORNER PERPETUATED BY R. W. HUTCHISON, P.E., IN 1958, MONUMENTED WITH AN AXLE SHAFT, 1-1/2" DIA, FIRMLY SET, PROJECTING 6" ABOVE GROUND, ALONGSIDE OF WHICH IS AN IRON PIPE, 3" DIA, FIRMLY SET, PROJECTING 5 FEET ABOVE GROUND, FROM WHICH A CEDAR STUMP 62" DIA (GLO BT) BEARS N6-1/2°E, 50 LINKS (33.00 FEET), WITH HEALED BLAZE; A CEDAR 31" DIA (GLO BT) BEARS S64°W, 39 LINKS (25.74 FEET), WITH AXE MARKS VISIBLE ON OPEN AND DECAYED BLAZE; A HEMLOCK SNAG 12" DIA (GLO BT) BEARS N16-1/4°W, 8 LINKS (5.28 FEET), NO MARKS VISIBLE ON OPEN AND DECAYED BLAZE; A FIR SNAG 20" DIA BEARS S27°E, 14 LINKS (9.24 FEET), WITH FRAGMENTARY SCRIBE MARKS VISIBLE ON PARTIALLY HEALED BLAZE; A HEMLOCK 18" DIA BEARS N33°W, 43 LINKS (28.38 FEET), WITH HEALED BLAZE. AT THE CORNER POINT SET AN IRON POST, 28" LONG, 2-1/2" DIA, 24" IN THE GROUND, WITH BRASS CAP MARKED "T14S R7W S3 S2 S10 S11 1976" FROM WHICH A CEDAR 18" DIA BEARS N87°E, 57 LINKS (37.62 FEET) MARKED "T14S R7W S2 BT"; A HEMLOCK 7" DIA BEARS S24-1/2°W, 22-1/2 LINKS (14.85 FEET) MARKED "T14S R7W S10 BT". RESET AXLE SHAFT AND IRON PIPE ALONGSIDE IRON POST.
- [04] BENTON COUNTY CORNER RESTORATION NO. 2499. TRANSCRIBED FROM RECORD [03] AND MAY CONTAIN ERRORS AND/OR OMISSIONS.
- [05] BUREAU OF LAND MANAGEMENT (BLM) NOTES BY DANNY J. NEVIN, CADASTRAL SURVEYOR, DATED OCTOBER 19, 1994. THE SECTION CORNER MONUMENTED WITH AN IRON POST, 2-1/2" DIA, FIRMLY SET, PROJECTING 4" ABOVE GROUND (ALONGSIDE OF WHICH IS AN AXLE, 1-1/2" DIA, FIRMLY SET, PROJECTING 6" ABOVE GROUND), WITH BRASS CAP MARKED "T14S R7W S3 S2 S10 S11 1976" FROM WHICH A CEDAR STUMP 62" DIA (GLO BT) BEARS N6-1/2°E, 50 LINKS (33.00 FEET), WITH HEALED BLAZE; A CEDAR 38" DIA (GLO BT) BEARS S64°W, 39 LINKS (25.74 FEET), WITH AXE MARKS VISIBLE ON OPEN AND DECAYED BLAZE; A HEMLOCK SNAG 10" DIA (GLO BT) BEARS N16-1/4°W, 8 LINKS (5.28 FEET), NO MARKS VISIBLE ON OPEN DECAYED BLAZE; A FIR SNAG 25" DIA BEARS S27°E, 14 LINKS (9.24 FEET), WITH ILLEGIBLE SCRIBE MARKS VISIBLE ON PARTIALLY HEALED BLAZE; A HEMLOCK 25" DIA BEARS N33°W, 43 LINKS (28.38 FEET), WITH HEALED BLAZE; A CEDAR 23" DIA (BLM BT) BEARS N87°E, 57 LINKS (37.62 FEET), WITH HEALED BLAZE; A HEMLOCK 15" DIA (BLM BT) BEARS S24-1/2°W, 22-1/2 LINKS (14.85 FEET), WITH HEALED BLAZE; A HEMLOCK 11" DIA BEARS S37°E, 9 LINKS (5.94 FEET) MARKED "T14S R7W S11 BT".
- [06] BUREAU OF LAND MANAGEMENT (BLM) NOTES BY ROBERT L. AARSETH, CADASTRAL SURVEYOR, DATED FEBRUARY 25, 2004. THE SECTION CORNER MONUMENTED WITH AN IRON POST, 2-1/2" DIA, FIRMLY SET, PROJECTING 4" ABOVE GROUND, (ALONGSIDE OF WHICH IS AN AXLE, 1-1/2" DIA, FIRMLY SET, PROJECTING 6" ABOVE GROUND, WITH 6" DIA FLANGE), WITH BRASS CAP MARKED "T14S R7W S3 S2 S10 S11 1976" FROM WHICH A CEDAR STUMP 62" DIA (GLO BT) BEARS N6-1/2°E, 33.0 FEET, WITH HEALED BLAZE; A CEDAR 39" DIA (GLO BT) BEARS S64°W, 25.7 FEET, WITH NO MARKS VISIBLE ON OPEN DECAYED BLAZE; A HEMLOCK SNAG 10" DIA (GLO BT) BEARS N16-1/4°W, 8 LINKS (5.28 FEET), NO MARKS VISIBLE ON OPEN DECAYED BLAZE; A FIR SNAG 25" DIA BEARS S27°E, 9.2 FEET, WITH SCRIBE MARKS "S11 BT" VISIBLE ON PARTIALLY HEALED BLAZE; A HEMLOCK 30" DIA BEARS N38°W, 28.4 FEET, WITH HEALED BLAZE; A CEDAR 31" DIA (BLM BT) BEARS N87°E, 37.6 FEET, WITH HEALED BLAZE; A HEMLOCK 19" DIA (BLM BT) BEARS S24-1/2°W, 14.8 FEET, WITH HEALED BLAZE; A HEMLOCK 14" DIA (BLM BT) BEARS S37°E, 5.9 FEET, WITH ILLEGIBLE SCRIBE MARKS VISIBLE ON PARTIALLY HEALED BLAZE.

FIRM/AGENCY: BENTON COUNTY SURVEYOR'S OFFICE**ADDRESS:** 360 S.W. AVERY AVE., CORVALLIS, OR 97333; PH. 541-766-6821**RESEARCH BY:** DAVID L. MALONE, P.L.S.**DATA ENTRY BY:** SAME

CORNER TO SECTION 2, 3, 10, AND 11; T 14 S, R 7 W, W. M.

2496

REESTABLISHMENT BY R. WILSON HUTCHISON, CERT. No. 2748 2/18/58

OLD BEARING TREES FOUND:

36" CEDAR, N 6° 30' E, 50 LKS OR 33.00 FT.
12" CEDAR, S 64° 00' W, 39 LKS OR 25.74 FT.
8" HEMLOCK, N 16° 15' W, 8LKS OR 5.28 FT, (POOR CONDITION)

OLD BEARING TREE GONE:

8" HEMLOCK, S 46° 30' E, 15 LKS OR 9.90 FT

SET TRUCK AXLE WITH 6" FLANGE, PAINTED YELLOW!

NEW BEARING TREES:

18" FIR, S 33° E, 7.80 FT, S11, B.T.
10" HEMLOCK, N 42° W, 28.2 FT, S3, B.T.

WITNESSES: NEIL J. LEDWARD, ROY E. WARNER, JR.

BENTON COUNTY SURVEYORS OFFICE - CORNER RESTORATION


2499

T. 14 S. R. 7 W. W. B. & M., BENTON COUNTY, OREGON

REPORTED BY Evans

SECTION 2

TITLE CADASTRAL SURVEYOR

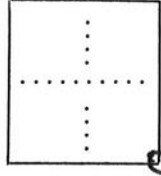

OFFICIAL CORNER FOUND

CORNER SET

Sec. CORNER COMMON TO SEC. 2 3 10 & 11
 is iron post 2 1/4 x 28" w/ brass cap

DESCRIBE

ADDITIONAL INFORMATION

62" cedar stump - N. 6 1/2° E., 50 IKs w/ healed blaze
 31" cedar - S. 64° W, 39 IKs w/ axe mks on open decayed blaze
 12" hemlock snag - N 16 1/2° W, 8 IKs w/ open decayed blaze
 20" fir snag - S 27° E, 14 IKs w/ scribe mks on healed blaze
 18" hemlock - N. 33° W, 43 IKs w/ healed blaze
 set 1 1/2" dia. axle shaft and 3" dia. iron pipe alongside of iron post

DATE MARCH 1977
 FOR ADDITIONAL INFORMATION SEE PGS. 14 AND 15 OF THE
 BLM. FIELD NOTES IN THE T-14S R-7W FILE IN THE CORNER
 RESTORATION CORRESPONDENCE FILE DRAWER (CJL 7/23/95)

LEGIBLE MARKS ON BEARING OBJECTS

T 14S	T 14S	
R 7W	R 7W	
S 2	S 10	
B T	B T	
Cedar	Hemlock	
18"	7"	
BEARING N 87° E	S. 24 1/2° W	
DISTANCE 57 1/2	22 1/2 IKs	
BT TAG POSTED		

OVER