

**149640200**

DATE 07/29/2020TOWNSHIP 14 SOUTH, RANGE 9 WEST, WILLAMETTE MERIDIAN; SECTION 25 CORNER SOUTH 1/4  
DONATION LAND CLAIM N/A CORNER N/A**COMMON CORNER(S):**

NORTH 1/4 CORNER SECTION 36

**RECORDS (INFORMATION IN BOLD ITALICS IS COUNTY STAFFS' INTERPRETATION OF THE RECORD)**

BASED ON EXTENSIVE RESEARCH AND RECOVERY OF EVIDENCE, THIS OFFICE HAS DETERMINED THAT MOST GENERAL LAND OFFICE SURVEYORS IN BENTON COUNTY BEFORE 1890 MEASURED TO THE FACE OF BEARING TREES.

- [01] GENERAL LAND OFFICE (GLO) NOTES BY ALONZO GESNER, D.S., DATED JUNE 15, 1892. SET CHITTEM WOOD POST 4 FEET LONG, 4" SQUARE, 24" IN THE GROUND, MARKED "1/4S" ON THE NORTH FACE, FROM WHICH A RED FIR 8" DIA BEARS N48°W, 13 LINKS (8.58 FEET), MARKED "1/4SBT"; RED FIR 8" DIA BEARS S37°E, 29 LINKS (19.14 FEET), MARKED "1/4SBT". A RED FIR 48" DIA LINE TREE BEARS S89°15'W, 0.32 CHAINS (21.12 FEET), MARKED WITH 2 NOTCHES ON THE EAST AND WEST SIDES.
- [02] BENTON COUNTY SURVEY NO. 3992 AND 3992-A, BY JAMES W. PROCHNAU, P.E., DATED AUGUST 26, 1964. FOUND ORIGINAL BEARING TREES NOW SNAGS. FOUND POST AND TACK IN PROPER POSITION.
- [03] BENTON COUNTY CORNER RESTORATION NO. 2840. TRANSCRIBED FROM RECORD [02] AND MAY CONTAIN ERRORS AND/OR OMISSIONS.
- [04] BENTON COUNTY SURVEY NO. 7245 BY GARY T. JOHNSTON, P.L.S., DATED FEBRUARY 7, 1981. FOUND SNAG STUMP 12" DIA (GLO BT) BEARS S37°E, 19.12 FEET, SCRIBES VISIBLE. RESET CORNER FROM THIS STUMP. SET 2-1/2" X 30" ALUMINUM PIPE WITH CAP MARKED "T14S R9W 25 1/4S 36 1980 RLS1467". SET 6' ORANGE FIBERGLASS POSTS 6.0 FEET EAST AND WEST WITH ATTENTION SIGNS. DOUGLAS FIR STUMP 22" DIA BEARS S64°W, 33.4 FEET TO 8" SPIKE IN TOP; DOUGLAS FIR STUMP 40" DIA BEARS N72°W, 11.2 FEET TO 8" SPIKE IN SOUTHEAST FACE.
- [05] BENTON COUNTY CORNER RESTORATION NO. 2842. TRANSCRIBED FROM RECORD [04] AND MAY CONTAIN ERRORS AND/OR OMISSIONS.
- [06] BENTON COUNTY SURVEY NO. 7723 BY GARY T. JOHNSTON, P.L.S., DATED FEBRUARY 8, 1985. FOUND 1980 ALUMINUM PIPE AND CAP PLUS BEARING TREES AND POSTS.
- [07] BENTON COUNTY SURVEY NO. 9371 BY GARY KEITH NYHUS, P.L.S., DATED DECEMBER, 1998. FOUND A 2-1/2" ALUMINUM PIPE WITH A 3-1/4" ALUMINUM CAP MARKED "T14S R9W 25 1/4S 36 1980 RLS 1467", 0.6' ABOVE GRADE, FROM WHICH A ROTTED AND BURNT FIR STUB 12" DIA (GLO BT), 1' HIGH WITH NO MARKS VISIBLE, BEARS S37°E, 19.1 FEET; BURNT FIR STUMP 26" DIA, 3' HIGH WITH A BOAT SPIKE IN THE CENTER, BEARS S64°W, 33.4 FEET; BURNT FIR STUMP 44" DIA, 7' HIGH WITH A BOAT SPIKE IN THE CENTER, BEARS N69°W, 12.0 FEET; ROTTED AND BURNT FIR STUB 16" DIA, 2' HIGH WITH NO MARKS VISIBLE, BEARS N48°W, 8.6 FEET. FIR 12" DIA BEARS N4°E, 11.8 FEET, SCRIBED "1/4 S25 BT" ON A DOUBLE BLAZE; FIR 7" DIA BEARS S69°E, 4.5 FEET, SCRIBED "1/4 S36 BT" ON A DOUBLE BLAZE; FIR 6" DIA BEARS S24°W, 6.9 FEET, SCRIBED "1/4 S36 BT" ON A DOUBLE BLAZE; FIR 7" DIA BEARS N58°W, 6.8 FEET, SCRIBED "1/4 S25 BT" ON A DOUBLE BLAZE.

**FIRM/AGENCY:** BENTON COUNTY SURVEYOR'S OFFICE  
**ADDRESS:** 360 S.W. AVERY AVE., CORVALLIS, OR 97333; PH. 541-766-6821  
**RESEARCH BY:** DAVID L. MALONE, P.L.S.  
**DATA ENTRY BY:** SAME

**BENTON COUNTY SURVEYORS OFFICE - CORNER RESTORATION**

(Siuslaw National Forest)

2840

T 14 S, R 9 W, W. B. & M., BENTON COUNTY, OREGON


SECTION 25

The information shown hereon was taken from  
the referenced county survey. Date: 7/30/90<sup>CJL</sup>

REPORTED BY James W. Prochnua

TITLE Engineer (1485)

DATE August 26, 1964

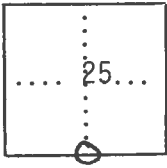

● OFFICIAL CORNER FOUND

○ CORNER SET

1/4 CORNER COMMON TO SEC. 25 & 36  
~~26~~

IS \_\_\_\_\_ DESCRIBE \_\_\_\_\_

**ADDITIONAL INFORMATION**

Found original B.T.'s new Snags

Found post and tack in proper position

See County Survey Number 3992

OVER

**LEGIBLE MARKS ON BEARING OBJECTS**


KIND

SIZE

BEARING

DISTANCE

BT TAG POSTED

BENTON COUNTY SURVEYORS OFFICE - CORNER RESTORATION

2842

T 14 S, R 9 W, W. B. & M., BENTON COUNTY, OREGON


REPORTED BY Gary Johnston

SECTION 25/36

TITLE PLS 1467

The information shown hereon was taken from  
the referenced county survey. Date: 7/30/90  
CJL

DATE Oct. 21, 1980

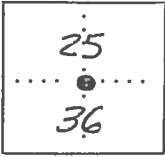

● OFFICIAL CORNER FOUND

○ CORNER SET

1/4 CORNER COMMON TO SEC. 25, 36, & \_\_\_\_\_  
IS 2 1/2" x 30" alum. pipe w/cap 20" in ground  
DESCRIBE

ADDITIONAL INFORMATION

Set 6' orange fiberglass posts 6.0 ft.  
East & West with USFS Attention signs  
Found Orig Bearing Trees: T145R9W  
12" snag stump S37°E 19'2A. 25 1/4 S  
scribes visible 36 1/4 S  
1980  
RLS1467

Refer to C.S. #7245

OVER

LEGIBLE MARKS ON BEARING OBJECTS

	<u>1/4 36</u>	<u>1/4 25</u>		
	<u>Set 8"</u>	<u>set 8"</u>		
	<u><del>Reathrod</del></u>	<u>Spike</u>		
	<u>Spike in</u>	<u>in top</u>		
	<u>top</u>			
	<u>stump</u>	<u>stump</u>		
KIND	<u>Douglas Fir</u>	<u>Douglas Fir</u>		
SIZE	<u>22"</u>	<u>40"</u>		
BEARING	<u>S69°W</u>	<u>N72°W</u>		
DISTANCE	<u>33.4 Ft.</u>	<u>11.2 Ft.</u>		
BT TAG POSTED	<input checked="" type="checkbox"/>	<input checked="" type="checkbox"/>		